


Materials, Supplies, & Cutting Diagram No. 153


Paneled Window Seat

A Box Sides (2)	$\frac{1}{2}$ ply. - 16 x 39 $\frac{1}{2}$	K Box Cap (1)	$\frac{1}{4}$ x 1 $\frac{1}{4}$ - 120 rgh.
B Box Ends (2)	$\frac{1}{2}$ ply. - 16 x 13	L Base Molding (1)	$\frac{9}{16}$ x 3 $\frac{3}{4}$ - 144 rgh.
C Box Bottom (1)	$\frac{1}{2}$ ply. - 13 x 39	M Panel Molding (3)	$\frac{5}{8}$ x 1 $\frac{1}{8}$ - 120 rgh.
D Side Corner Stiles (4)	$\frac{3}{4}$ x 2 - 17 $\frac{1}{4}$	N Lid Panel (1)	$\frac{1}{2}$ ply. - 17 $\frac{1}{4}$ x 43 $\frac{1}{4}$
E End Corner Stiles (4)	$\frac{3}{4}$ x 1 $\frac{3}{4}$ - 17 $\frac{1}{4}$	O Lid Edging (1)	$\frac{1}{4}$ x $\frac{1}{2}$ - 130 rgh.
F Top Side Rails (2)	$\frac{3}{4}$ x 2 $\frac{3}{8}$ - 37	P Lid Molding (1)	$\frac{5}{8}$ x 1 $\frac{1}{8}$ - 144 rgh.
G Bottom Side Rails (2)	$\frac{3}{4}$ x 4 $\frac{3}{4}$ - 37		
H Top End Rails (2)	$\frac{3}{4}$ x 2 $\frac{3}{8}$ - 11		
I Bottom End Rails (2)	$\frac{3}{4}$ x 4 $\frac{3}{4}$ - 11	• (30) #8 x 1" Fh Woodscrews	
J Side Dividers (4)	$\frac{3}{4}$ x 2 - 8 $\frac{7}{8}$	• (248) 1" Brads	
		• (112) $\frac{3}{4}$ " Brads	

$\frac{1}{2}$ " - 48" x 96" Birch Plywood

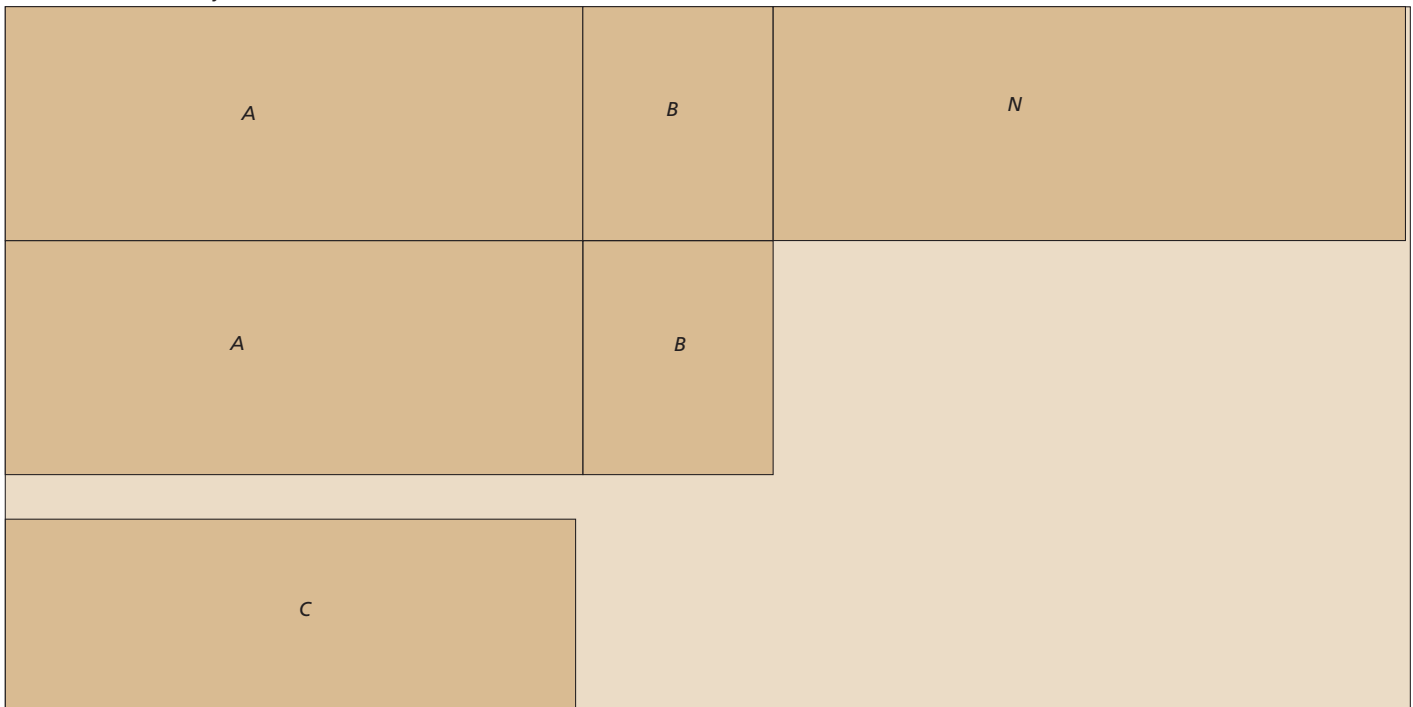

$\frac{3}{4}$ " x 9" - 96" Poplar (6 Bd. Ft.)

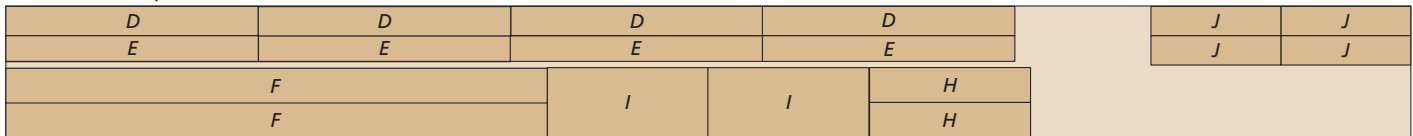

$\frac{3}{4}$ " x 9" - 96" Poplar (6 Bd. Ft.)

